

Resistive Sensors

Rotary Type


RDC40/RDC50 Series

Compact, high precision, high heat resistant rotary sensors, meet various needs in position detection.

Magnetic Sensor

Piezo Sensor

Resistive Sensor

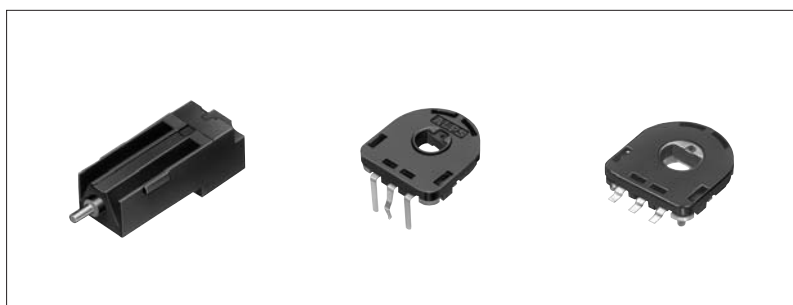

Features

- Uses potentiometer system.
- Analog output facilitates signal processing.
- Provides stable output characteristics against external noise and temperature changes.

Applications

- Rotation angle detecting sensors in car air conditioners, projectors, digital cameras and photo copiers
- Joint angle detections in robots
- Digital video cameras
- Car navigation systems

Typical Specifications

Items	Specifications
Rating voltage	5V DC
Rotational torque	2mN·m max.
Operating life	1,000,000cycles (RDC40:100,000cycles)
Total resistance	10kΩ
Total resistance tolerance	±30%

Product List

Mounting method	Effective variable range	Linearity	Hollow shaft variation	Operating life (cycles)	Model No.	Minimum packing unit (pcs.)※	Drawing No.
Connector type	13rotations	±1%	—	100,000	RDC401D07A	770	1
Horizontal type	320°	±2%	φ 3.5 dia	1,000,000	RDC501015A	1,500	2
			φ 3.5 dia with radius		RDC501011A		3
Vertical type			φ 3.5 dia		RDC502006A	1,600	4
Reflow type			φ 3.5 dia with radius		RDC503013A	1,300	5
			φ 3.5 dia with radius		RDC503015A		6
Reflow type(Low-profile)			φ 4 dia		RDC506002A	1,200	7





Notes

1. Additional product specifications in response to those not included in the above recommended products are also available.
2. ※The minimum packing unit is the basic unit quantity of your order. Please place purchase orders in integer multiples of the minimum packing unit. Please contact us for export packaging details.

For other product specifications, see P.30

■ Dimensions

Unit:mm

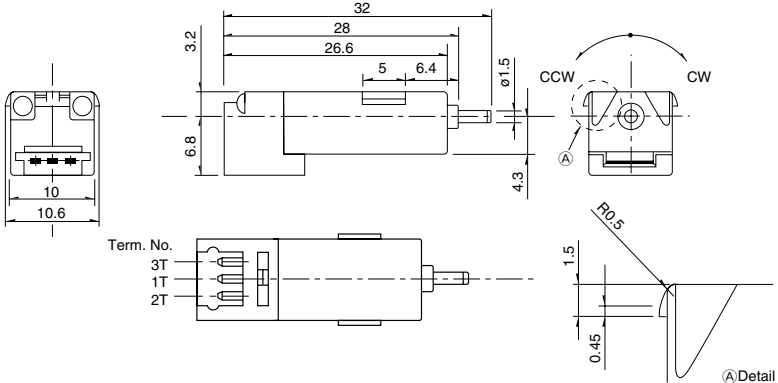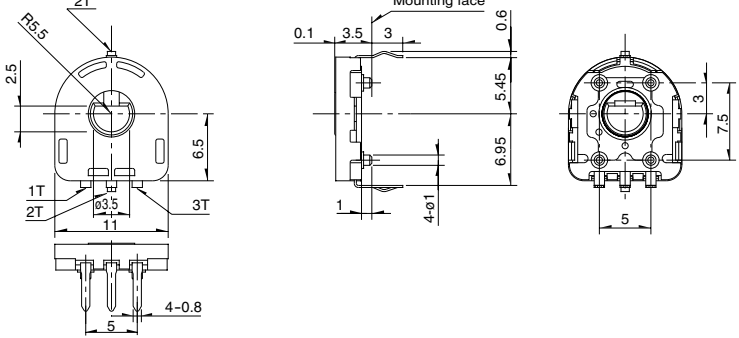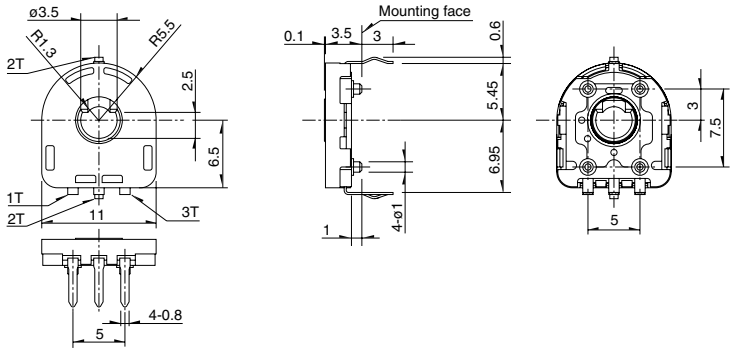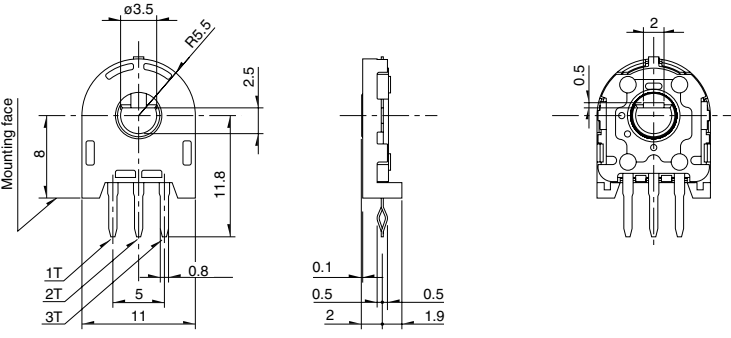No.	Photo	Style
1	RDC40 (Multiple turns type) 	 Technical drawings for RDC40 (Multiple turns type) showing dimensions and terminal details. The main view shows a cylindrical body with a diameter of 10.6 mm and a length of 32 mm. The terminal block has a width of 10 mm and a height of 6.8 mm. The terminal pins are labeled 3T, 1T, and 2T. The detail view shows a mounting face with a radius of R0.5 and a height of 1.5 mm. The detail view also shows a mounting face with a radius of R0.5 and a height of 0.45 mm. The detail view also shows a mounting face with a radius of R0.5 and a height of 0.45 mm.
2	RDC501 (Horizontal type) 	 Technical drawings for RDC501 (Horizontal type) showing dimensions. The main view shows a cylindrical body with a diameter of 11 mm and a length of 6.5 mm. The terminal block has a width of 5 mm and a height of 4-0.8 mm. The terminal pins are labeled 1T, 2T, and 3T. The detail view shows a mounting face with a radius of R5.5 and a height of 0.1 mm. The detail view also shows a mounting face with a radius of R5.5 and a height of 0.1 mm.
3	RDC501 (Horizontal type, $\phi 3.5$ dia with radius) 	 Technical drawings for RDC501 (Horizontal type, $\phi 3.5$ dia with radius) showing dimensions. The main view shows a cylindrical body with a diameter of 11 mm and a length of 6.5 mm. The terminal block has a width of 5 mm and a height of 4-0.8 mm. The terminal pins are labeled 1T, 2T, and 3T. The detail view shows a mounting face with a radius of R5.5 and a height of 0.1 mm. The detail view also shows a mounting face with a radius of R5.5 and a height of 0.1 mm.
4	RDC502 (Vertical type) 	 Technical drawings for RDC502 (Vertical type) showing dimensions. The main view shows a cylindrical body with a diameter of 11 mm and a length of 11.8 mm. The terminal block has a width of 5 mm and a height of 0.8 mm. The terminal pins are labeled 1T, 2T, and 3T. The detail view shows a mounting face with a radius of R5.5 and a height of 0.1 mm. The detail view also shows a mounting face with a radius of R5.5 and a height of 0.1 mm.

Magnetic
Sensor

Piezo
Sensor

Resistive
Sensor





■ Dimensions

Unit:mm


Magnetic
Sensor

Piezo
Sensor

Resistive
Sensor

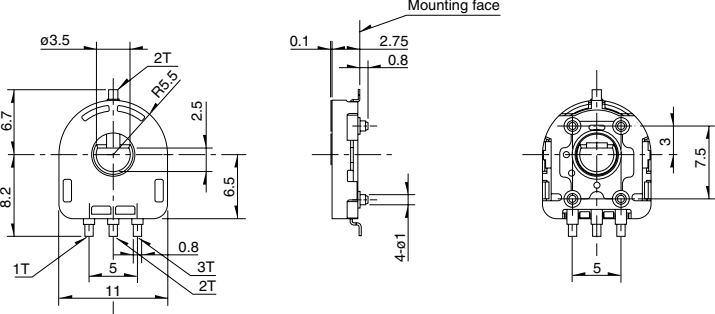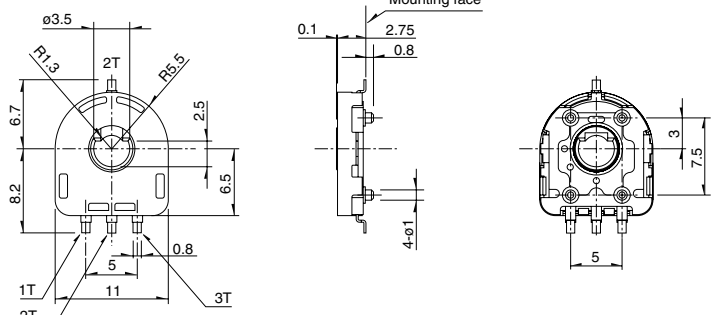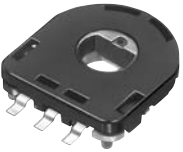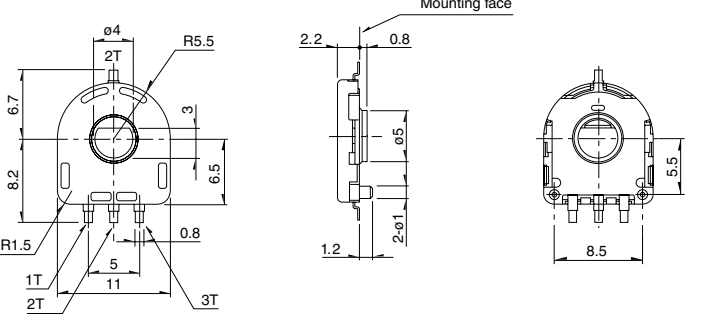No.	Photo	Style
5		
6		
7		

■ Circuit Diagram

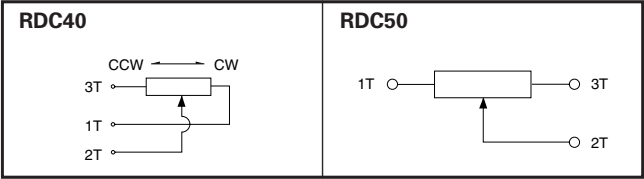


Taping Specifications

Taping Specifications in Model RDC503, RDC506


Unit:mm

Dimension of embossed tape

RDC503

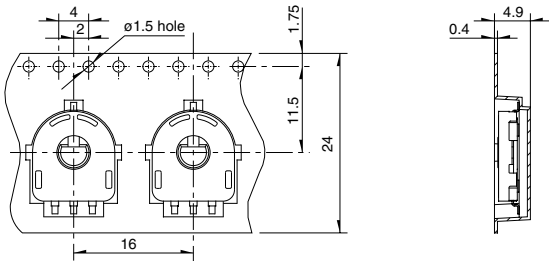


RDC506

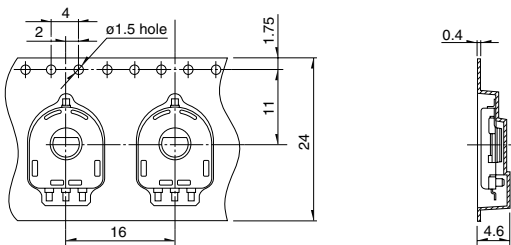


Reel dimensions

Number of packings (pcs.)	
RDC503	1,300
RDC506	1,200

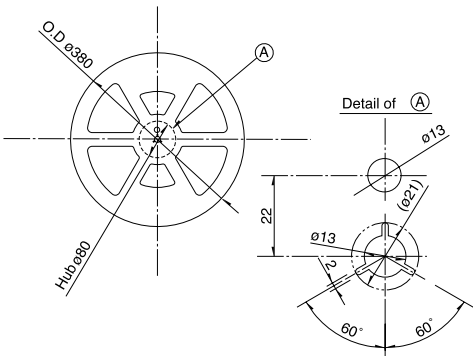

Sealing conditions

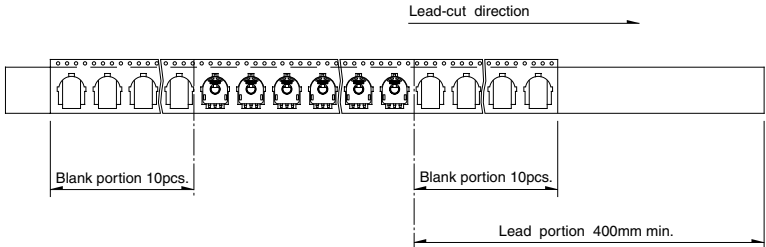

Magnetic
Sensor
Piezo
Sensor
Resistive
Sensor


Product Specifications

Style Model Item		Rotary type			Linear type	
		RDC40	RDC501/RDC502/ RDC503/RDC506	RDC80	RDC10	RD7
Operating temperature range		−30℃ to +80℃	−40℃ to +120℃		−30℃ to +85℃	−40℃ to +105℃
Electric performance	Total resistance tolerance	±30%				±20%
	Resistance taper	Linear				
	Rated voltage	5V DC				12V DC
	Max. operating voltage	18V DC	16V DC		5V DC	18V DC
	Linearity	±1%	±2%	±3%	±0.5%	±1%
Mechanical performance	Effective variable range	13rotations	320°	330° (1-phase) 360° (2-phase)	S (travel)−2mm	S (travel)
	Rotational angle	——	(Without stopper)		——	
	Rotational torque	2mN•m max.		10mN•m max.		
	Operating force	——			0.25N max.	2N less.
Durability	100,000cycles	●	——	●	——	●
	200,000cycles	——			●	——
	1,000,000cycles	——	●	——		

Method for Regulating the Linearity


Model RDC40

1. Reference taper : 90%/13rotations
2. VA is measured output value

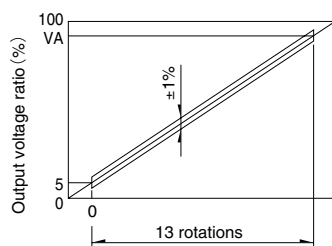


Model RDC50

1. Reference taper : 100%/333.3°
2. Index point is 50% output point

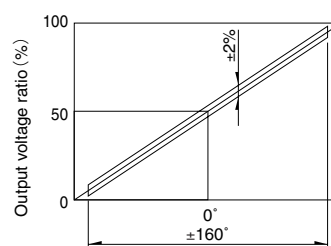


Model RDC80

1. Reference taper : 100%/340°
2. The center is in the configuration diagram condition

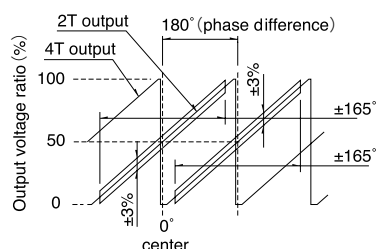

Model RDC10/RD7

With rated voltage applied between terminals 1 and 3, the straight line which connects the measured output values VB and VA at specified reference positions B and A is assumed to be an ideal straight line, so that deviation against the ideal straight line when the voltage applied between terminals 1 and 3 is assumed to be 100% can be expressed as a percentage.

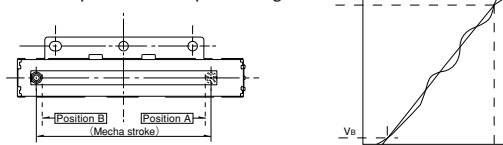


Soldering Conditions

Soldering Conditions

1. Recommended reflow conditions

Magnetic Sensor
Piezo Sensor
Resistive Sensor

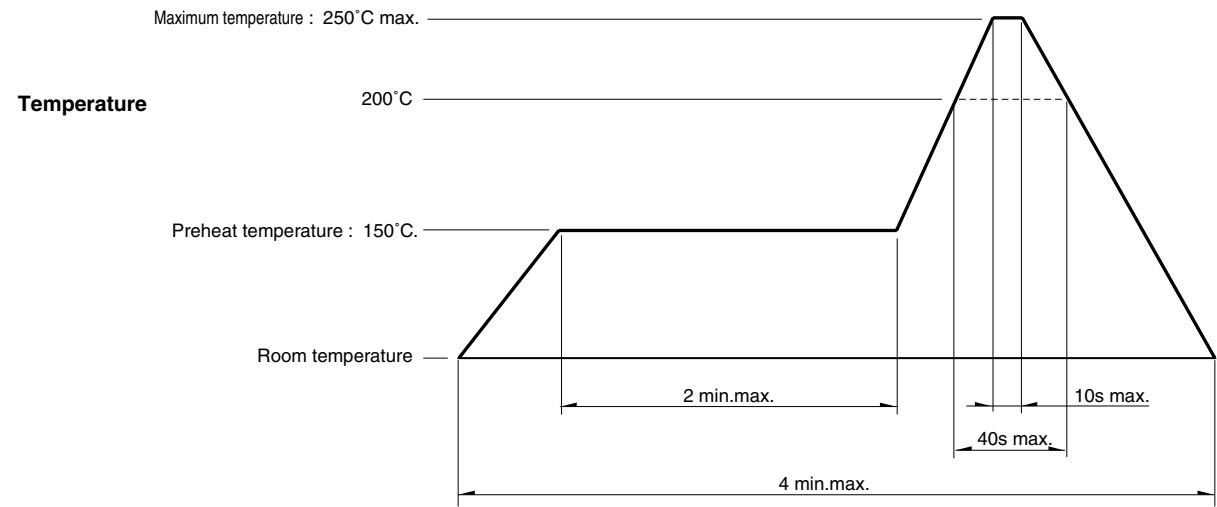

- 2. Cleaning Cleaning should not be attempted.
- 3. Type of solder to be used Use cream solder that contains 10 - 15 %wt flux.
- 4. Number of solder applications - apply solder only once

Notes

- 1. When using an infrared reflow oven, solder may not always be applied as intended. Be sure to use a hot air reflow oven or a type that uses infrared rays in combination with hot air.
- 2. The temperatures given above are the maximum temperatures at the terminals of the potentiometer when employing a hot air reflow method. The temperature of the PC board and the surface temperature of the potentiometer may vary greatly depending on the PC board material, its size and thickness. Ensure that the surface temperature of the potentiometer does not rise to 250°C or greater.
- 3. Conditions vary to some extent depending on the type of reflow bath used. Be sure to give due consideration to this prior to use.

Measurement and Test Methods

Analog Output Contact Type Sensor

[Total Resistance]

The total resistance, with the shaft (lever) placed at the end of terminal 1 or 3, shall be determined by measuring the resistance between the resistor terminals 1 and 3 unless otherwise specified.

[Rating Voltage]

The rating voltage corresponding to the rated power shall be determined by the following equation. When the resulting rated voltage exceeds the maximum operating voltage of a specific resistor, the maximum operating voltage shall be taken as the rated voltage.

$E=\sqrt{P \cdot R}$
E : Rated voltage (V) P : Rated power (W) R : Total nominal resistance (Ω)